
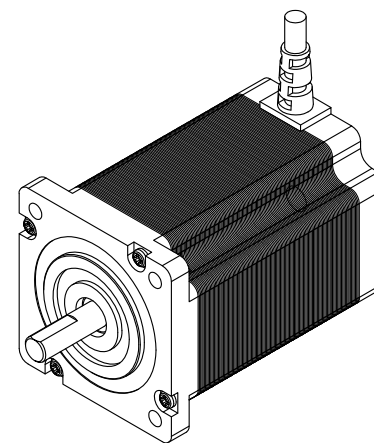
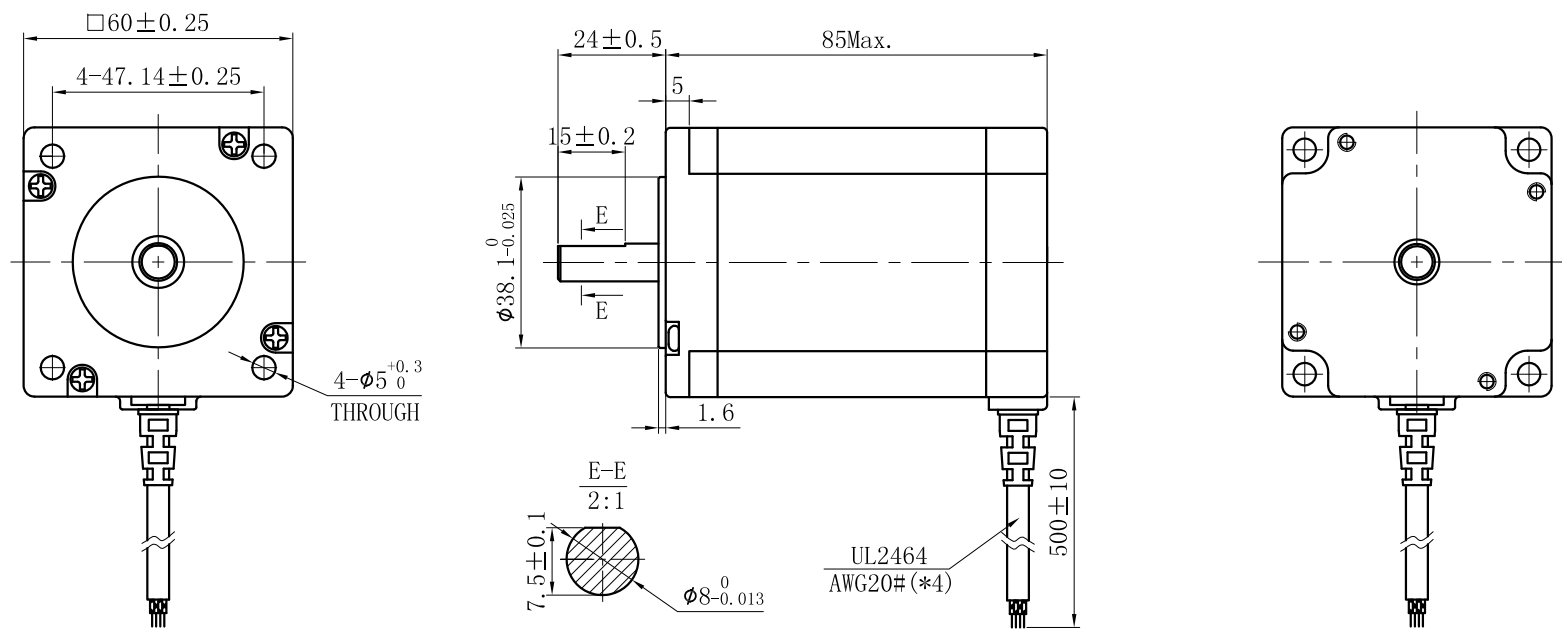




相数	2	额定工作状态	连续
基本步距角	1.8°	寿命 (小时)	5000H以上
基本步距角误差 (空载)	±0.09° 以下	温升	80 K以下
额定电流	5.0 A	绝缘耐压	500V A.C
电阻 (相)	0.43 Ω±10%	绝缘电阻	100MΩ以上
电感 (相)	1.7 mH±20%	绝缘等级	B
保持力矩	3.2 N.m	使用温度范围	0° C~+50° C
转子惯量	≈690 g.cm ²	使用温度范围	20%RH~90%RH
重量	≈1.3 Kg	保存温度范围	-20° C~+70° C
径向跳动	0.025 MM (负载450g)	保存湿度范围	15%RH~95%RH
轴向跳动	0.075 MM (负载920g)		

变更内容 Revision Record	电机引线颜色及接线图	励磁顺序（2相励磁）	标签内容																									
初次发放		<table> <tr> <th>Step</th> <th>A</th> <th>B</th> <th>A-</th> <th>B-</th> </tr> <tr> <td>1</td> <td>+</td> <td>+</td> <td>-</td> <td>-</td> </tr> <tr> <td>2</td> <td>-</td> <td>+</td> <td>+</td> <td>-</td> </tr> <tr> <td>3</td> <td>-</td> <td>-</td> <td>+</td> <td>+</td> </tr> <tr> <td>4</td> <td>+</td> <td>-</td> <td>-</td> <td>+</td> </tr> </table>	Step	A	B	A-	B-	1	+	+	-	-	2	-	+	+	-	3	-	-	+	+	4	+	-	-	+	
Step	A	B	A-	B-																								
1	+	+	-	-																								
2	-	+	+	-																								
3	-	-	+	+																								
4	+	-	-	+																								
签字The signature	注：电机引出线颜色和线序以实物为准	初始方向：按照表的励磁顺序从安装面看顺时针方向																										
日期 Date																												
2019.11.21																												

客户签字确认							视图方式:		 SMH2404 两相混合式步进电机	
	标记	处数	更改文件号	签名	年	月	日			
	设计			标准化				比例	1:1	 汉德保电机
	校核			工艺						
	审核			批准						
	图样标记	H						共 1 张 第 1 张		
										 汉德保电机 深圳市德智高新有限公司 WWW.HARDBOY.NET